
# **AITHER**

### Thea Linear Chandelier

Installation Instructions

INSTALLATION MUST BE PERFORMED BY A QUALIFIED ELECTRICIAN PLEASE USE THE FOLLOWING DIAGRAM AND STEPS FOR INSTALLATION

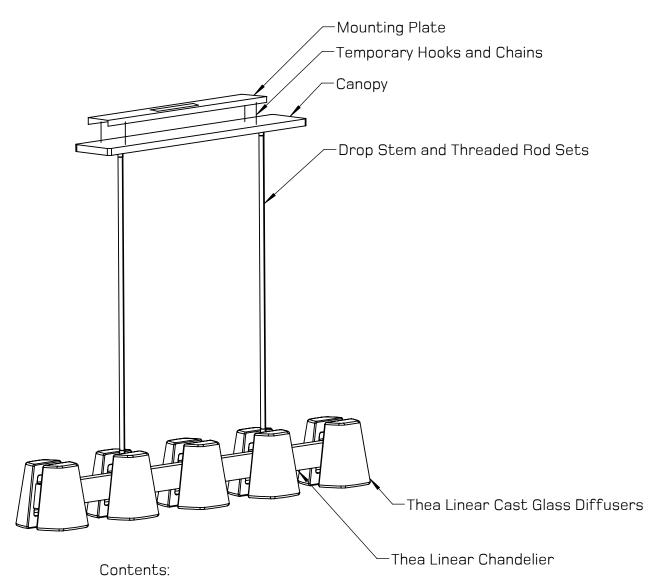

- (1) Thea Linear Chandelier
- (1) Canopy
- (1) Mounting Plate with ground wire
- (2) Drop Sleeve and Threaded rod sets
- (4) Sets Temporary Hooks and Chains
- (2) 1/4 NPS Nuts
- (2) Lockwashers
- (10) Thea Linear Cast Glass Diffusers
- (3) Blue Wire Nuts
- (2) Pair White Gloves
- (1) .06 Hex Key

# **AITHER**

### Thea Linear Chandelier

Installation Instructions

INSTALLATION MUST BE PERFORMED BY A QUALIFIED ELECTRICIAN PLEASE USE THE FOLLOWING DIAGRAM AND STEPS FOR INSTALLATION

#### **INSTALLATION INSTRUCTIONS:**

- 1. Make sure all power is shut off to the J-Box (Junction Box) where the fixture will be installed.
- 2. Check the orientation of the mounting plate. There are alignment marks/labels on mounting plate and canopy.
- 3. Secure mounting plate to ceiling with appropriate hardware and/or anchors per installation requirements.

NOTE: Mounting requirements and hardware to be determined and provided by installer.

- 4. Hang temporary chains from mounting plate, raise canopy and hang from temporary chains.
- 5. Feed wires from fixture through Threaded rods and Drop Sleeves. Screw threaded rods into fixture until snug. Raise fixture with threaded rods attached and feed wires into canopy, secure threaded rods with nuts and lock washers inside of canopy.
- 6. Make electrical connections in the canopy. Connect the low voltage red wires from each Drop Sleeve into the nearby lever connector marked "POS" and the black low voltage wires into the lever connector marked "NEG". Make electrical connections from Main wiring harness to J-Box. Ground fixture using pre-installed ground wire. If not using 0-10V Dimming, cap purple and gray wires with wire nuts and tape. Secure all excess wires.
- 7. Remove the temporary chains and install the canopy to the mounting plate. Lift and slide Canopy into mounting plate until canopy seats onto on mount plate slots. Make sure to lift canopy evenly on ends and in middle to keep flat while installing. Take note of alignment marks/labels to aid in ensuring correct engagement of canopy to mounting plate. Secure Canopy to Mounting Plate with set screw.

NOTE: Ensure excess wires are properly secured to prevent damage while installing canopy to mounting plate.

8. Match the labeled Thea Cast Glass Diffusers to their labeled locations on chandelier. Slide glass in place and secure with provided hex key. Install glass from the center out, alternating sides to ensure glass is installed in a balanced manner.

#### Wiring Diagram Downlight Driver TO JUNCTION BOX Cast Glass Driver To Cast Glass LEDS TO JUNCTION BOX (N) (L) (N)(L) DRIVER **DRIVER** 40 Wat.t. 30 Watt 1400 mA 500 mA 24 V 24-42 V GRY PURPLE 8 GRAY WIRES ARE FOR 0-10V DIMMING ONLY. REFER TO SWITCH MANUFACTURER FOR WIRING. CAP WIRES IF NO 0-10V DIMMING. TO FIXTURE PURPLE 8 GRAY WIRES ARE FOR 0-10V DIMMING ONLY. REFER TO SWITCH MANUFACTURER FOR WIRING. CAP WIRES IF NO 0-10V DIMMING. WEIGHT: 200 lbs NOTE: DO NOT OVER TIGHTEN SCREWS UL Approved in the US and Canada. REV 9/20/2024