
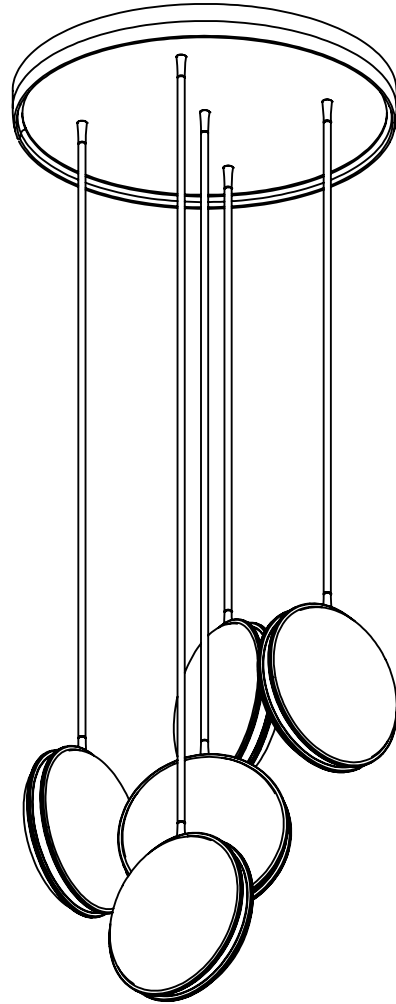


AITHER

Monos 5 Pendant Round Chandelier

Installation Instructions

INSTALLATION MUST BE PERFORMED BY A QUALIFIED ELECTRICIAN
PLEASE USE THE FOLLOWING DIAGRAM AND STEPS FOR INSTALLATION

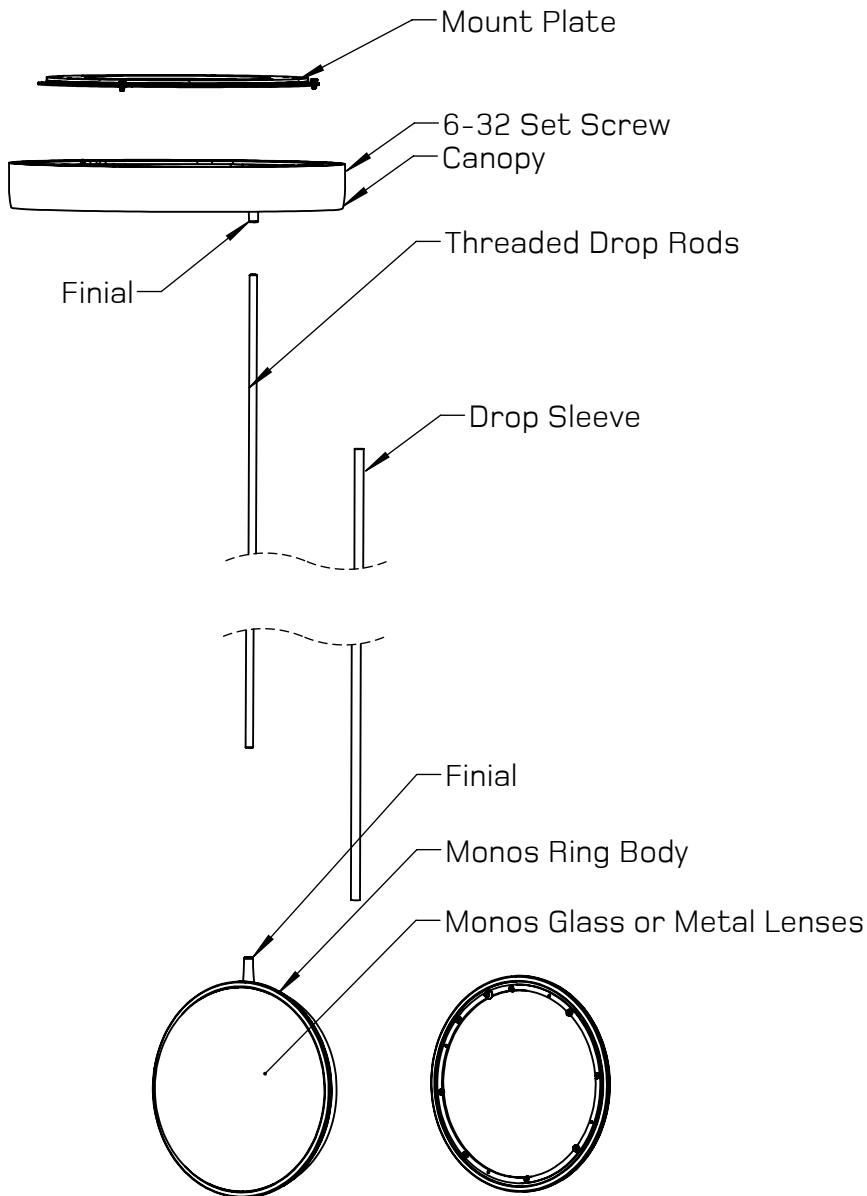

Contents:

- (1) Mounting Plate
- (1) Canopy
- (5) Monos Ring Bodies
- (10) Monos Glass or Metal Lenses
- (5) Drop Sleeves
- (5) Threaded Drop Rods
- (1) 6-32 Set Screw
- (1) 1/16" Hex Wrench
- (2) Pair, White Gloves
- (5) Installation Chain Sets

AITHER

Monos Chandelier

Installation Instructions

INSTALLATION MUST BE PERFORMED BY A QUALIFIED ELECTRICIAN
PLEASE USE THE FOLLOWING DIAGRAM AND STEPS FOR INSTALLATION

INSTALLATION INSTRUCTIONS:

1. Make sure all power is shut off to the J-Box (Junction Box) where the fixture will be installed.
2. Check the orientation of the mounting plate. There are alignment marks/labels on mounting plate and canopy.
3. Secure mounting plate to ceiling with appropriate hardware and/or anchors per installation requirements.

NOTE: Mounting requirements and hardware to be determined and provided by installer.

4. Hang temporary chains from the mounting plate, raise canopy and hang from the temporary chains.

NOTE: Align the circle and square cutouts on Canopy and Mounting Pan.

5. Attach pendants to canopy. Pendants, drop sleeves, threaded drop rods, and lenses are all labeled to match. Start with the shortest set (labeled "1"). Feed the wires from the ring body through the matching label threaded drop rod, drop sleeves, and into the Canopy hole labeled '1'. Thread the drop rod into the ring body finial, then into the matching canopy finial.

NOTE: Thread drop rods an equal amount into each of the Canopy and Ring Body Finials. Tighten until drop sleeves bottom out on each finial. DO NOT OVERTIGHTEN.

6. Repeat this for the next length (labeled "2"), continue until all pendants are hung. DO NOT ATTACH LENSES IN THIS STEP.
7. Make electrical connections in the canopy. Connect the low voltage red wires from each pendant hole into the nearby lever connector marked "POS" and the black low voltage wires into the lever connector marked "NEG". Make electrical connections from wiring harness to J-Box. Ground fixture using pre-installed ground wire. If not using 0-10V Dimming, cap purple and gray wires with wire nuts and tape. Secure all excess wires. See wiring diagram. Note 1 driver per pendant.
8. Remove the temporary chains and install the canopy to the mounting plate. For round canopies lift and twist (clockwise when viewed from bottom) into place until canopy hits stop. For Rectangular canopies, lift and slide into place until canopy hits stop. Use 6-32 set screw to lock the canopy and mounting plate together. Take note of alignment marks/labels to aid in ensuring correct engagement of canopy to mounting plate.

NOTE: Ensure excess wires are properly secured to prevent damage while installing canopy to mounting plate.

9. Match the labeled lenses with the labeled ring bodies. Carefully place the standoffs on the Glass or Metal Faces into the openings of the aluminum rings in the Ring Bodies, then turn clockwise until the Faces stop turning and are locked into place. Make sure all standoffs have locked into their respective slots and there is no gaps or uneven spaces between Glass or Metal Faces and Ring Bodies.

AITHER

Monos Chandelier

Installation Instructions

INSTALLATION MUST BE PERFORMED BY A QUALIFIED ELECTRICIAN
PLEASE USE THE FOLLOWING DIAGRAM AND STEPS FOR INSTALLATION

WIRING DIAGRAM

